


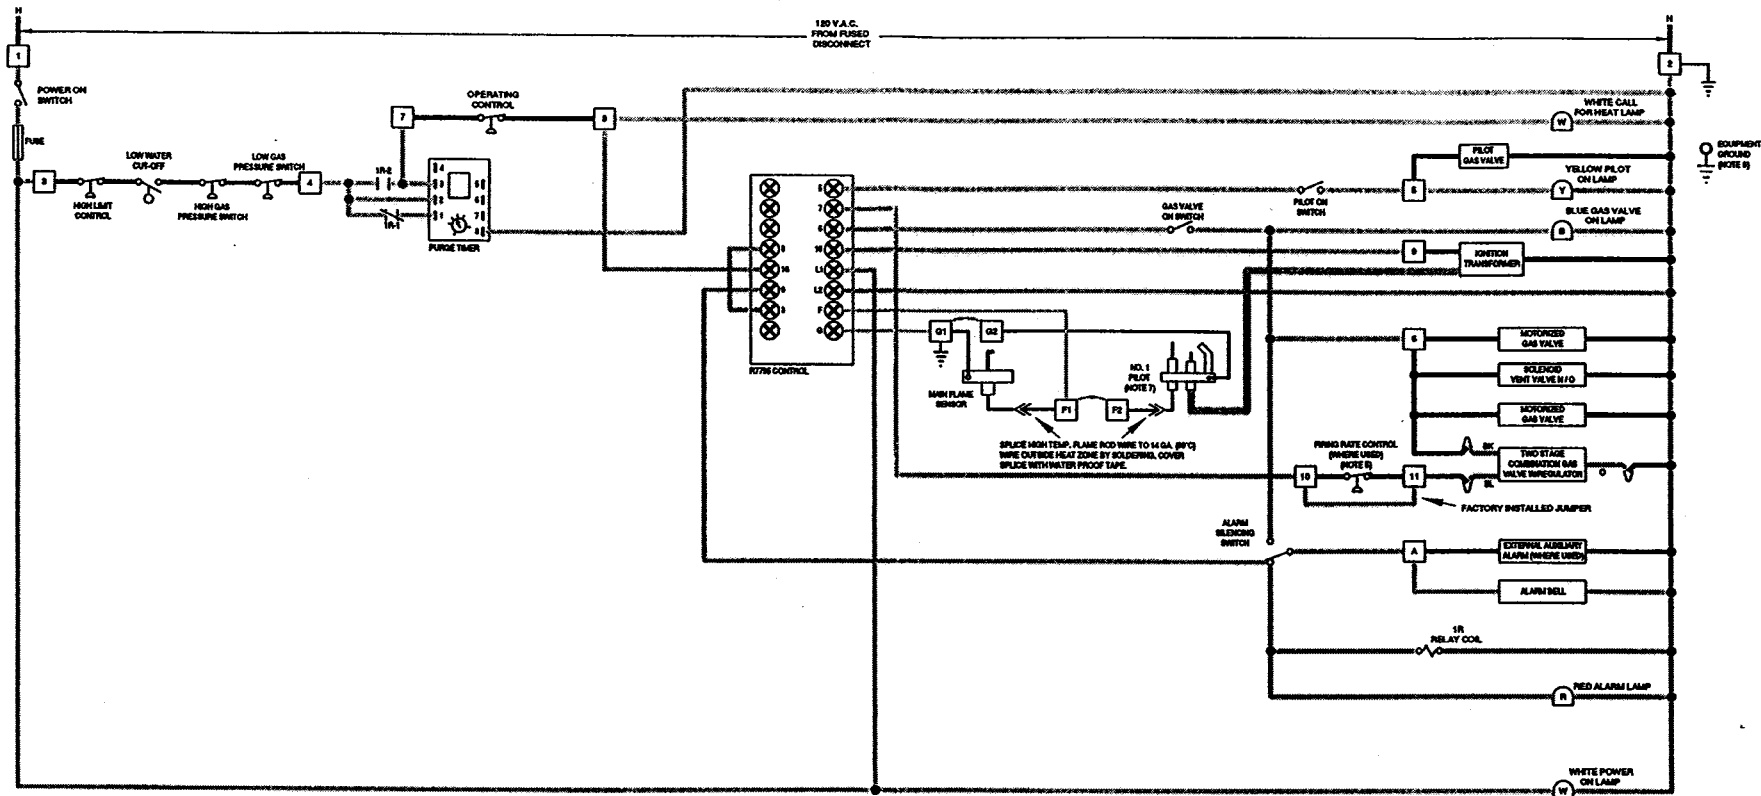

WARNING

ELECTRICAL SHOCK HAZARD, CAN CAUSE SEVERE INJURY OR DEATH.
DISCONNECT POWER BEFORE INSTALLING AND/OR SERVICING.

NOTES:

- ALL WIRING MUST BE INSTALLED IN ACCORDANCE WITH:
 - U.S.A. - NATIONAL ELECTRICAL CODE AND ANY OTHER NATIONAL, STATE OR LOCAL CODE REQUIREMENTS HAVING JURISDICTION.
 - CANADA - C.S.A. C22.1 CANADIAN ELECTRICAL CODE PART 1 AND ANY OTHER NATIONAL, PROVINCIAL OR LOCAL CODE REQUIREMENTS HAVING JURISDICTION.
- ALL SAFETY CIRCUIT WIRING MUST BE:
 - U.S.A. - N.E.C. CLASS 1.
 - CANADA - C.S.A. C22.1 O.E.C. PART 1.
- IF ORIGINAL WIRE AS SUPPLIED WITH THE APPLANCE MUST BE REPLACED, TYPE 105°C OR ITS EQUIVALENT MUST BE USED.

- REFER TO CONTROL COMPONENT INSTRUCTIONS PACKED WITH BOILER FOR APPLICATION INFORMATION.
- REMOVE FACTORY INSTALLED JUMPER WHEN FPMG RATE CONTROL IS USED.
- REFER TO CONTROL SUPPLEMENT FOR GROUND LEADWIRE ATTACHMENT. IF ORIGINAL GROUND LEADWIRE AS SUPPLIED MUST BE REPLACED, TYPE 115°C OR EQUIVALENT MUST BE USED.
- PLOT LEADWIRES ARE NOT FIELD REPLACEABLE. REPLACE PLOT ASSEMBLY IF NECESSARY.
- PLOT LEADWIRES ARE NOT FIELD REPLACEABLE. REPLACE PLOT ASSEMBLY IF NECESSARY.
- IGNITER FIELD INSTALLED CHASSIS GROUND.
- ALL CONTACTS SHOWN WITHOUT POWER APPLIED - OFF SHIELD CONDITION.

LOW VOLTAGE FIELD
HIGH VOLTAGE FIELD
LOW VOLTAGE FACTORY
HIGH VOLTAGE FACTORY
IGNITION/SENSING CABLE

- ┆ PURGE TIMER TERMINAL
- WAMP PANEL TERMINAL
- WAMP PANEL LAMP
- ⊗ RT76 CONTROL TERMINAL

LGB
WMFP-1F

• WIRING DIAGRAM
• REV. 6 THRU 12

WEIL-McLAIN

A Division of The Marley Company
Michigan City, Indiana 46360

PART NUMBER 550-224-668/1291WM